

Version 212 Update

Version 212 (5/25/21) firmware is now available on Dealer Resources (www.dmp.com/company/dealer-services/product-software).

Effective June 14th, 2021, all COM Series Universal Communicators are being manufactured with Version 212 firmware.

COM Series Features

EasyConnect AP

COM Series Communicators with built-in Wi-Fi can now use the EasyConnect AP process. This process allows the installer to connect the communicator to the desired Wi-Fi network with a mobile phone, tablet, or laptop.

The communicator will broadcast an SSID of **DMP** followed by the communicators serial number (ex. DMP12345678). Navigate to your Wi-Fi settings and select the communicators SSID in order to connect to it. Once connected, open a browser and type in 192.168.1.1. The **Connection Settings** page will load. The **Connection Settings** page allows you to select the Wi-Fi network you would like your communicator to use and it also allows you to type in the password for that network. Once the information has been entered and saved the Connection Settings page will no longer be available.

There is also a button labeled WPS. Pressing this button makes the Wi-Fi module enter WPS communication for 3 minutes. Once the communicator is in the WPS process, press the WPS button on the desired Wi-Fi router in order to complete the connection.

ECP Partition Number Selection

Previously, communicators were only able to manage the first partition programmed into the host panel. With Version 212, a new programming option has been added to **System Options** that gives users the ability to specify which partition the communicator is located in. When the host panel is armed or disarmed via the communicator, only the partition where the communicator is located will be armed or disarmed.

Send Stored Messages Support

COM Series Communicators are now able to use the Send Stored Messages feature in System Reports. This allows the communicator to store any messages that are not sent in the event of a communication failure, and send them when communication is restored, and functions exactly the same as it does on an XT50 panel.

COM Series Enhancements

Improved CID Capture

Version 212 firmware resolves an issue where the communicator would send the incorrect area number when for any area after 15.

ECP/DSC Setup

ECP and DSC Setup can now be triggered by Dealer Admin and the Tech APP. In order to use this feature, the installer code must be sent to the communicator.

Supporting Software Updates

- Dealer Admin Version 2.64.0
- Remote Link Version 2.12

Obtaining the New Firmware

COM Series firmware updates are available, free of charge, on Dealer Admin or www.dmp.com/company/dealer-services/product-software.